


## TRIAD™ RECEPTACLE


### SURFACE MOUNT INSTALLATION INSTRUCTIONS

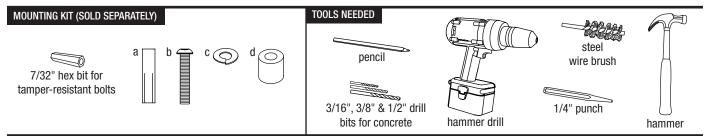

### STEP BY STEP

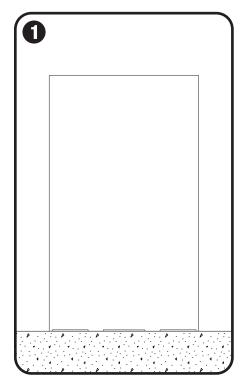

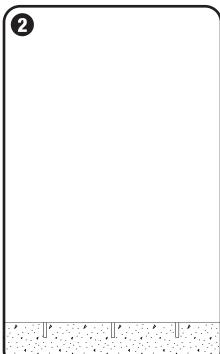

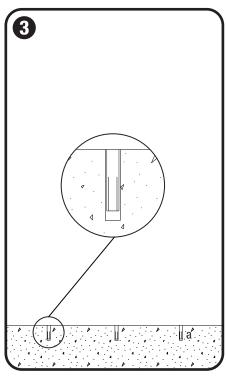

#### Mark hole locations

 Place receptacle in desired location.
Mark center of each mounting hole location in base with a pencil.

### **Drill holes**

 Use hammer drill to drill 1-7/8" deep x 1/2" diameter anchor hole at each marked location using a 1/2" drill bit suitable for concrete drilling.

NOTE: Forms+Surfaces recommends starting holes with 3/16" diameter drill bit followed by 3/8" and finally 1/2" for maximum accuracy.

## Insert & set anchors

- Use compressed air and steel wire brush to clean each anchor hole.
- Insert 3/8"-16 x 1-1/2" anchor (a) into each anchor hole and use hammer to tap anchor tops flush with ground level.
- Use 1/4" punch and hammer to set anchors by driving down the center of each anchor until it stops.


FORMS+SURFACES®


# TRIAD™ RECEPTACLE


SURFACE MOUNT INSTALLATION INSTRUCTIONS

## STEP BY STEP FOR ALL SURFACE MOUNTED TRIAD RECEPTACLES (16 GALLON SECTION VIEW SHOWN)

5

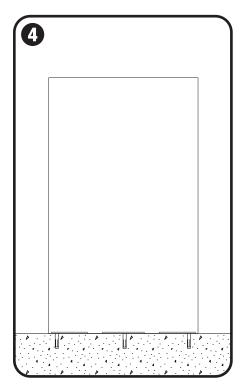

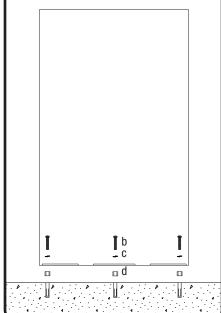

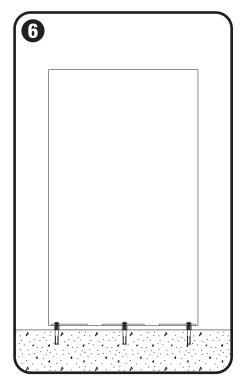

## Position receptacle

• Position receptacle so that mounting holes line up with anchors.

### Attach receptacle

- Slide 3/8" stainless steel lock washer (c), onto each 3/8"-16 x 1-1/2" tamperresistant button head cap bolt (b).
- Insert bolts into mounting holes and aluminum spacers (d) in receptacle and thread into anchors using 7/32" hex bit for tamper-resistant bolts.

## Tighten bolts

- Tighten bolts until snug.
- Place liner inside receptacle, then place lid on top.